

Golder Associates Inc.

44 Union Boulevard, Suite 300
Lakewood, CO USA 80228
Telephone (303) 980-0540
Fax (303) 985-2080



**INTERNATIONAL CYANIDE MANAGEMENT CODE
GOLD MINING OPERATION VERIFICATION AUDIT
LAGUNAS NORTE MINE, PERU**

SUMMARY REPORT

Submitted to:

*Minera Barrick Misquichilca S.A.
Av. Victor Andres Belaunde 171, 2do Piso
San Isidro
Lima 27, Peru*

and

*International Cyanide Management Institute
1200 G Street N.W, Suite 800
Washington, D.C. 20005*

Submitted by:

*Golder Associates Inc.
44 Union Boulevard, Suite 300
Lakewood, Colorado 80228*

December 6, 2007

073-81689

Name of Project: Lagunas Norte Mine

Project Owner / Operator: Minera Barrick Misquichilca S.A., a wholly owned subsidiary of Barrick Gold Corporation

Name of Responsible Manager: Hugo Roman, Operations Manager

Address and Contact Information: Lagunas Norte Mine
Libertad, Peru

Minera Barrick Misquichilca S.A.
Av. Victor Andres Belaunde 171, 2do Piso
San Isidro
Lima 27, Peru

Email: HRoman@barrick.com
Telephone: + 51 1 612 4100 ext 4411


Audit Dates: October 22-25, 2007

Location and Description of Operation

The Lagunas Norte Mine, operated by Barrick Gold Corporation’s Peruvian wholly owned subsidiary Minera Barrick Misquichilca S.A. (MBM), is located in the Alto Chicama Mining District in north-central Peru (Province of Santiago de Chuco, District of Quiruvilca, Departament of the Libertad), 140 kilometers east of the coastal city of Trujillo. The property is situated in the Peruvian Andes Mountains at an elevation of 4,000 to 4,260 meters above sea level and straddles the continental divide. The area is considered to have a mountainous climate, and the vegetation consists of small shrubs and grass. The mine is accessed by road from year round from Trujillo and Huamachuco. The climate in the project area is characterized by defined rainy and dry seasons. The rainy season extends from November to April when approximately 1 meter (m) of rainfall occurs.

Lagunas Norte is comprised of an open pit mine, two waste rock storage areas, a geomembrane lined heap leaching facility, process and storm water pond system, acid rock drainage treatment plant, barren solution treatment plant using the INCO SO₂ process, and a Merrill Crowe processing plant to recover gold, silver and mercury as a by-product. The open pit has been developed by conventional mining methods using trucks and loaders to extract gold-bearing ore. The waste is transported by trucks to either the west or east storage area designed specifically for this purpose. Ore is placed on the heap leach facility by truck. The heap leach facility is fully lined with geomembrane and drains by gravity to a Pregnant Leach Solution (PLS) Pond with an emergency overflow to the Process Overflow Pond (POP) that provides storage for extreme storms and draindown. The PLS Pond is covered with birdballs to prevent wildlife access. The heap leach facility has a “dynamic” pad area where carbon ore and/or ore with high fines content is placed for a one-time leach cycle. The dynamic pad ore, after a 60-day leach cycle, is loaded and hauled to another portion of the heap leach facility for permanent storage. The dynamic pad drains pregnant solution to a series of netted sediment ponds that flow to the PLS Pond. Gold is recovered using conventional methods of heap leaching with dilute sodium cyanide solution for a 45-day leach cycle. Understanding and managing the process water balance is a critical function at Lagunas Norte because of the relatively high precipitation occurring in a well-defined rainy season. Lagunas Norte has developed and implemented a comprehensive process water balance program that includes monitoring and regular updates to track and plan water management activities. Lagunas Norte uses “raincoats” on the heap

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date


leach facility to minimize infiltration of rainfall on inactive portions of the heap. The raincoats are high-density polyethylene (HDPE) geomembrane covers that convey clean precipitation to the storm water management system. The auxiliary facilities required for the mining operation include administration offices and buildings, laboratories, warehouses, maintenance shops, emergency facilities, electric power distribution, water supply, roads, fuel and reagent storage tanks, drainage structures, and explosive storage areas. Once the ore has been extracted and processed, all the Lagunas Norte facilities except those necessary for continuous environmental protection will be closed and rehabilitated.

Lagunas Norte uses a Merrill Crowe process to recover the gold and silver from the pregnant leach solution. Lagunas Norte has two secure cyanide storage areas: 1) solid sodium cyanide box warehouse, and 2) liquid mixing and storage area within the Merrill Crowe building. Lagunas Norte has developed and implemented a number of operational procedures for the safe storage, handling and mixing of solid sodium cyanide briquettes into high-strength cyanide solution. The cyanide storage mixing and storage tanks are under a roof and within concrete containments with spill collection sumps. The area has appropriate ventilation and hydrogen cyanide (HCN) monitoring, and high-level alarms to prevent overfilling. Cyanide is added to the barren solution tank located outside in the Tank Farm area. pH control is maintained by adding lime to the heap leach ore. Lagunas Norte stores and manages sodium cyanide in engineered tanks, pipelines and lined ponds constructed under appropriate quality control and quality assurance programs. All pipelines are color coded to identify the content with the flow directions marked. Lagunas Norte employees are trained in cyanide hazards and first aid, first response, emergency response, and specific operational tasks. Lagunas Norte has a perimeter chain link fence with razor wire to prevent wildlife, livestock and unauthorized personnel access to the property. Within the property, key facilities are fenced to preclude wildlife and livestock from entering cyanide process areas. Lagunas Norte employs comprehensive inspection and preventive maintenance programs to assure that all cyanide equipment and facilities are functioning as designed and to monitor process solutions. Lagunas Norte has developed closure and reclamation plans and procedures to complete the appropriate management of cyanide solutions and solids, and the decontamination of cyanide pipelines and equipment. Peru is in the process of establishing financial assurance requirements for closure. Lagunas Norte has submitted a closure plan and cost estimate for the decommissioning and reclamation of the facilities. Until the Peruvian financial assurance requirements for Lagunas Norte are approved and implemented, Barrick has provided information that indicates the company meets the financial tests for a corporate guarantee for the closure of the mine.

Lagunas Norte receives solid sodium cyanide from DuPont De Nemours & Co., Inc. (DuPont) delivered to the site in the original sea containers. The DuPont sodium cyanide supply chain has been audited for due diligence and compliance with the ICMC by qualified Code auditors. The sodium cyanide supply chain is managed by DuPont, a signatory company to the Code and certified as compliant with the Code by third-party auditors. Lagunas Norte has sufficient warehouse storage capacity to limit the number of cyanide deliveries during the rainy season. Lagunas Norte has an emergency response team that is trained to respond to onsite fires, chemical spills and worker exposures to cyanide. Lagunas Norte works with local community emergency responders to assure that adequate resources are available to address both offsite and onsite emergencies.

Audit Dates: October 22-25, 2007
Auditors: Scott Miller, Lead Auditor
Guillermo Aguirre, Gold Mining Technical Expert Auditor
Mark Montoya, Outside Gold Mining Technical Expert Auditor

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

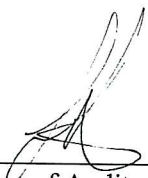
in full compliance with
The operation is in substantial compliance with **All Code Principles**
 not in compliance with

Audit Company: **Golder Associates Inc.**
Audit Team Leader: **Scott H. Miller, CEA**
E-mail: Scott.Miller@golder.com

Names and Signatures of Other Auditors:

Guillermo Aguirre

Guillermo Aguirre
Name of Auditor




Signature of Auditor

Dec. 6, 2007
Date

Mark A. Montoya, P.E.

Mark A. Montoya
Name of Auditor



Signature of Auditor

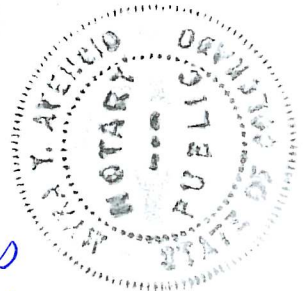
Dec. 6, 2007
Date

I attest that I meet the criteria for knowledge, experience and conflict of interest for Code Verification Audit Team Leader, established by the International Cyanide Management Institute and that all members of the audit team meet the applicable criteria established by the International Cyanide Management Institute for Code Verification Auditors.


I attest that this Summary Audit Report accurately describes the findings of the verification audit. I further attest that the verification audit was conducted in a professional manner in accordance with the International Cyanide Management Code Verification Protocol for Gold Mine Operations and using standard and accepted practices for health, safety and environmental audits.



Myra G. Atencio
Notary Public, State
of Colorado
My commission expires
11/01/2010



Lagunas Norte Mine
Name of Facility



Signature Lead Auditor

Dec. 6, 2007
Date

1. PRODUCTION: *Encourage responsible cyanide manufacturing by purchasing from manufacturers who operate in a safe and environmentally protective manner.*

Standard of Practice 1.1: *Purchase cyanide from manufacturers employing appropriate practices and procedures to limit exposure of their workforce to cyanide, and to prevent releases of cyanide to the environment.*

in full compliance with
The operation is in substantial compliance with **Standard of Practice 1.1**
 not in compliance with

Basis for Audit Finding: Lagunas Norte has committed to only purchase cyanide from producers that are compliant with the International Cyanide Management Code (ICMC). Barrick Gold Corporation (Barrick) has a supply contract with DuPont De Nemours & Co., Inc. (DuPont) to provide sodium cyanide at Lagunas Norte. DuPont has been audited by third party independent auditors and certified as compliant under the ICMC.


2. TRANSPORTATION: *Protect communities and the environment during cyanide transport.*

Standard of Practice 2.1: *Establish clear lines of responsibility for safety, security, release prevention, training and emergency response in written agreements with producers, distributors and transporters.*

in full compliance with
The operation is in substantial compliance with **Standard of Practice 2.1**
 not in compliance with

Basis for Audit Finding: Lagunas Norte has a sodium cyanide supply contract with DuPont, which specifies that the operation take ownership of the cyanide at the time of delivery. DuPont is by contract solely responsible for the production and transport of sodium cyanide to the delivery point at Lagunas Norte. DuPont is a signatory producer to the ICMC and subcontracts the supply chain transportation from Memphis, Tennessee to the mine. The supply chain is comprised of truck and rail transportation to the Port of New Orleans, Louisiana. From New Orleans, the sodium cyanide is shipped to one of two ports in Peru: Calleo or Salaverry. An agent representing DuPont in Peru manages the logistics for interim storage and truck transportation to the mine. None of the supply chain subcontractors are signatory to the ICMC; however all subcontractors have been subject of a formal audit or a less formal due diligence by an ICMI-qualified auditor. According to these third-party audit and due diligence reports the transportation subcontractors are compliant or at least consistent with the ICMC with clear lines of responsibility for safety, security, release prevention, training, and emergency response.

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

Standard of Practice 2.2: *Require that cyanide transporters implement appropriate emergency response plans and capabilities and employ adequate measures for cyanide management.*

in full compliance with


The operation is in substantial compliance with **Standard of Practice 2.2**

not in compliance with

Basis for Audit Finding: DuPont is by contract solely responsible for the production and transport of cyanide to the delivery point at Lagunas Norte. The supply chain is comprised of truck and rail transportation to the Port of New Orleans, Louisiana. DuPont loads intermediate bulk container (IBC) plywood boxes into sea cargo containers. The Intermodal Cartage Co. Inc. (ICCI) trucking company picks up these sea containers for transportation to a rail yard for transportation by the Canadian National Railway (CN). ICCI, while not signatory nor certified by ICMI as compliant with the ICMC, has undergone a third-party audit by an ICMI approved auditor and has been described as fully compliant. CN is also not signatory, nor certified by ICMI, but an ICMI certified third-party auditor indicates that DuPont has done appropriate due diligence associated with the CN transportation segment to ensure that the cyanide is transported in a “manner consistent with the requirements of the Cyanide Code Transportation Protocol”. CN transports the sea containers to the Port of New Orleans. From New Orleans, the sodium cyanide is shipped to one of two ports in Peru: Calleo or Salaverry. DuPont uses the Mediterranean Shipping Company S.A. (MSC) for this segment of the supply chain. MSC is also not signatory, nor certified by ICMI, but an ICMI certified third-party auditor indicates that DuPont has done appropriate due diligence associated with the CN transportation segment to ensure that the cyanide is transported in a “manner consistent with the requirements of the Cyanide Code Transportation Protocol”. DuPont uses a Peruvian agent, DuQuimica S.A. to manage the logistics for interim storage and truck transportation to the mine. DuPont and DuQuimica use Transportes Rodrigo Carranza S.A.C. (TRC), a truck transportation company, to provide interim storage and transportation from the Ports of Calleo or Salaverry either directly to the mine or to interim storage prior to transportation of the sea containers to the mine. TRC, while not signatory nor certified by ICMI as compliant with the ICMC, has undergone a third-party audit by an ICMI approved auditor and has been described as fully compliant.

DuPont is a signatory producer to the ICMC and has conducted audits and due diligence by qualified third-party independent auditors on the transportation security, safety, training and emergency response aspects. None of the supply chain subcontractors are signatory to the ICMC; however all subcontractors have been subject of a formal audit or a less formal due diligence by an ICMI qualified auditor. According to these third-party audit and due diligence reports the transportation subcontractors are compliant or at least consistent with the ICMC with clear lines of responsibility for safety, security, release prevention, training, and emergency response.

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

3. HANDLING AND STORAGE: *Protect workers and the environment during cyanide handling and storage.*

Standard of Practice 3.1: *Design and construct unloading, storage and mixing facilities consistent with sound, accepted engineering practices, quality control/quality assurance procedures, spill prevention and spill containment measures.*

- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 3.1**
- not in compliance with


Basis for Audit Finding: Lagunas Norte has a secure solid sodium cyanide warehouse where one-ton “bag in box” containers are located away from people and surface waters. Liquid cyanide is stored in a locked room within the Merrill Crowe process area and the area has restricted access. The process facilities are located away from surface water bodies. The solid sodium cyanide briquettes are mixed with barren solution in cyanide mixing and storage tanks within the Merrill Crowe Plant building. The design and construction of the cyanide warehouse, mixing and storage facilities have been completed appropriately as documented in final design and construction drawings prepared by qualified Professional Engineers. The cyanide warehouse, mixing and storage facility quality control and assurance procedures and documentation include construction level drawings with detailed specifications noting foundation compaction and concrete reinforcement, and piping and tankage materials. The liquid cyanide storage tanks each have a high-level alarm and level indicator. The solid cyanide warehouse storage facility has adequate ventilation, is located within a secure and roof-covered building. The cyanide mixing and storage area is also a secure locked room within the larger Merrill Crowe plant building with adequate fan driven ventilation. During unloading at both sites, traffic and access is controlled by the operators with warning cones. The cyanide warehouse and the mixing and storage areas are within concrete containment to contain releases and precipitation that may contact cyanide. As also covered under Standard of Practice 4.7, the mixing and liquid storage containment area is constructed for spill prevention and the containments sized to contain 110 % of largest tank volume. Both the warehouse and the mixing / storage area are locked and control room personnel must provide permission for entry.

Standard of Practice 3.2: *Operate unloading, storage and mixing facilities using inspections, preventive maintenance and contingency plans to prevent or contain releases and control and respond to worker exposures.*

- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 3.2**
- not in compliance with

Basis for Audit Finding: Lagunas Norte has developed Standard Operating Procedures (SOPs) to prevent exposure and releases of cyanide during unloading from the sea cargo containers and stacking, mixing and storage, and processing. The SOPs consist of “*PROCEDIMIENTO Transporte*,

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

Manipulacion, Descarga, Almancenamiento y Despacho de Cianuro de Sodio (Procedure – Transportation, Handling, Unloading, Storage and Control of Sodium Cyanide)” and *Preparación de Cianuro* (Preparation of Cyanide)” that covers the responsibilities for the transportation on the site and the site handling and storage. In addition Lagunas Norte has developed illustrated instructions for the operation of critical valves (Manejo de Valvulas Criticas). The Lagunas Norte procedures include detailed information on the operation of valves and couplings during the mixing. The procedures require that cyanide boxes be stacked no more than three high during unloading of trucks or within the warehouse. The procedures also require that all cyanide mixing be completed by qualified operators with a minimum of three operators present. Personnel protection equipment requirements during cyanide box movement or cyanide mixing include a Tyvek® suit, hardhat, full-face dust mask, rubber boots, and gloves. Lagunas Norte thoroughly rinses the bags and then disposes of the bags and boxes at the incinerator. Incineration is considered an environmentally sound method for the disposal of the bags and boxes. Strict controls are in place to prevent other uses of these materials. Lagunas Norte uses inspection forms and a computer database preventative maintenance program that identifies and tracks all maintenance activities at the unloading and the storage warehouse and tank areas. As also covered under Standard of Practice 4.1, Lagunas Norte has an inspection program that includes daily shift inspections. Findings are entered into work orders when required. Contingency planning documents have been developed and implemented to address power failure, and extreme rainfall management.

4. OPERATIONS: *Manage cyanide process solutions and waste streams to protect human health and the environment.*

Standard of Practice 4.1: *Implement management and operating systems designed to protect human health and the environment utilizing contingency planning and inspection and preventive maintenance procedures.*


in full compliance with

The operation is in substantial compliance with **Standard of Practice 4.1**

not in compliance with

Basis for Audit Finding: Lagunas Norte has developed and implemented operator task-specific SOPs that address protection of human health and the environment for the operation of the Merrill Crowe circuit. In addition, Lagunas Norte has Operating Plans and task-specific SOPs that describe all aspects of the heap leach, water balance and water treatment operations. These SOPs and operating plans were found to have adequate contingency planning, routine inspections, and a preventive maintenance program. SOPs address all the cyanide management tasks such as unloading and storage of cyanide boxes, mixing of liquid cyanide, cleaning and disposal of cyanide bags and boxes, management of the ore placement and heap leach operations, and operation of the cyanide destruct circuit. Contingency planning documents have been developed and implemented to support the process solution and pond management, control of solution inventory during power failure, and extreme rainfall events. Lagunas Norte has two backup generators to ensure that essential process equipment and systems continue to operate during power failures and conducts inspections that include regular testing of the backup power generator. Lagunas Norte uses a computer based preventative maintenance system, Oracle®, to identify, issue work orders and document all preventative maintenance activities.

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

Standard of Practice 4.2: *Introduce management and operating systems to minimize cyanide use, thereby limiting concentrations of cyanide in mill tailings.*

in full compliance with
The operation is in substantial compliance with **Standard of Practice 4.2**
 not in compliance with

Basis for Audit Finding: Pierina is a heap leach operation and does not generate or dispose mill tailings.

Standard of Practice 4.3: *Implement a comprehensive water management program to protect against unintentional releases.*

in full compliance with
The operation is in substantial compliance with **Standard of Practice 4.3**
 not in compliance with


Basis for Audit Finding: Lagunas Norte has developed a comprehensive water balance that addresses the uncertainty and variability of climatic data to prevent overtopping of the heap leach facilities and process ponds. Process facility inspection procedures and data collection programs have been implemented to regularly update and calibrate the water balance model during the rainy season. Lagunas Norte has a weather station and measures and records precipitation data for incorporation into the model and operational planning. Daily shift inspections include pond levels and available freeboard monitoring that is incorporated into the water balance model and operational planning to prevent potential overtopping.

Standard of Practice 4.4: *Implement measures to protect birds, other wildlife and livestock from adverse effects of cyanide process solutions.*

in full compliance with
The operation is in substantial compliance with **Standard of Practice 4.4**
 not in compliance with

Basis for Audit Finding: Lagunas Norte has heap leach process ponds in the area of the dynamic pad and the Pregnant Leach Solution (PLS) Pond that contain process solution with WAD cyanide concentrations at or above 50 mg/L. All the dynamic pad process pond are netted to protect bird and wildlife exposure and the PLS Pond is covered with birdballs. Lagunas Norte's other wildlife protection facilities include a perimeter fence around the entire property. During periods of high rainfall, ponding on the surface of the heap leach facility is controlled by the placement of netting frames, reduction of solution application or by shutting down solution

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

application in the ponding areas. Excess barren process solution can be treated at the cyanide destruction plant and discharged.

Standard of Practice 4.5: Implement measures to protect fish and wildlife from direct and indirect discharges of cyanide process solutions to surface water.


- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 4.5**
- not in compliance with

Basis for Audit Finding: Lagunas Norte is designed and operated for zero-discharge of process fluids unless treated for discharge under Peruvian regulations and covered under an industrial discharge permit. Lagunas Norte discharges treated process water as required in response to high rainfall conditions. Lagunas Norte has Class III Water Class authorizations (Resolucion Directoral from the Ministry of Health) to discharge treated barren solution from the Polishing Pond. The Class III authorization covers the in-stream receiving water quality with a maximum limitation of 0.1 mg/L WAD cyanide. There is also an authorization for effluent discharge from the Polishing Pond that has a 0.2 mg/L WAD cyanide standard. Process data collected daily during periods of cyanide destruction in the Polishing Pond prior to discharge were reviewed and indicated a range of WAD cyanide values of 0.012 to 0.029 mg/L. Data for the discharge solution and flows in the outfall from the Polishing Pond indicated that WAD concentrations ranged up to 0.13 mg/L in the outfall, which is below the standard established by the MEM, and were below detection (<0.005 mg/L) at all other downgradient sampling points. Review of the operation performance history, design criteria and the project water balance indicate that facilities operation is consistent with the water quality requirements. Monitoring information indicates there is no impact to groundwater or surface water quality from the heap leach operations and processing facilities. Spill prevention and emergency response plans have been developed to comply with the zero-discharge operating requirements.

Standard of Practice 4.6: Implement measures designed to manage seepage from cyanide facilities to protect the beneficial uses of groundwater.

- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 4.6**
- not in compliance with

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

Basis for Audit Finding: The Lagunas Norte heap leach and processing facilities are designed and operated to protect groundwater resources. The project cyanide facilities include a number of seepage control technologies: double geomembrane liner systems below the solution process ponds with leak detection and leak collection systems; composite liner under the heap leach facility; and concrete containments in process areas to protect the beneficial water use. Lagunas Norte completes weekly monitoring of the leak detection systems and monthly water quality sampling and analysis of a groundwater monitoring network. The numerical standard established for groundwater protection at Lagunas Norte is 0.08 mg/l WAD cyanide for the Class I beneficial use, Domestic Provision with Simple Disinfection. Groundwater monitoring data demonstrate that the operation has not exceeded this numerical standard at the groundwater compliance points or downgradient of the operation, and that the operation is protective of the designated beneficial use of groundwater.

Standard of Practice 4.7: *Provide spill prevention or containment measures for process tanks and pipelines.*

in full compliance with

The operation is in substantial compliance with **Standard of Practice 4.7**

not in compliance with

Basis for Audit Finding: The Lagunas Norte operation has secondary curbed or walled concrete containments for all cyanide storage and processing areas. Other secondary containments include geomembrane-lined channels for process solution pipelines. The secondary containments in the cyanide processing areas have been designed to contain at least 110 % of the largest tank volume. Secondary containments in the cyanide mixing room and process areas have automated pumping systems for collection and management of process leakage. SOPs have been developed to address management of spill response and clean-up within the containments. Review of the operation indicates that all tanks, piping and containments are constructed of materials appropriate for handling high pH cyanide solutions.

Standard of Practice 4.8: *Implement quality control/quality assurance procedures to confirm that cyanide facilities are constructed according to accepted engineering standards and specifications.*


in full compliance with

The operation is in substantial compliance with **Standard of Practice 4.8**

not in compliance with

Basis for Audit Finding: The project construction of the heap leach and process facilities has been verified by qualified engineering companies and includes detailed quality control / quality assurance (QC/QA) data collection and documentation. The QC/QA documents indicate that the construction was completed according to engineering standards and specifications. Lagunas Norte has committed to retain all QC/QA information in the Environmental or Process Departments.

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

Standard of Practice 4.9: *Implement monitoring programs to evaluate the effects of cyanide use on wildlife, surface and ground water quality.*

- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 4.9**
- not in compliance with

Basis for Audit Finding: Lagunas Norte has environmental monitoring programs developed to evaluate the performance of the cyanide management systems on wildlife, and surface and groundwater quality. The environmental programs have been prepared, approved and implemented by qualified professionals and include all appropriate sampling and analysis documentation. Review of field sampling forms, chain of custody and quality assurance data was completed. Lagunas Norte monitors monthly and reports water quality to the Peruvian Ministry of Energy and Mines for 17 groundwater monitoring wells and 17 surface water stations on a trimester basis.

5. DECOMMISSIONING: *Protect communities and the environment from cyanide through development and implementation of decommissioning plans for cyanide facilities.*

Standard of Practice 5.1: *Plan and implement procedures for effective decommissioning of cyanide facilities to protect human health, wildlife and livestock.*


- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 5.1**
- not in compliance with

Basis for Audit Finding: Lagunas Norte has developed written closure plans and cost estimates that address decommissioning of all cyanide equipment, pipelines and facilities including management of heap leach draindown solution. Lagunas Norte has developed an implementation schedule that considers the treatment and evaporation of all process solution, detoxification and rinsing of equipment, and removal and decommissioning of ponds and other containments. Lagunas Norte is required to update the closure plan and estimated costs on an annual basis per Barrick's internal requirements.

Standard of Practice 5.2: *Establish an assurance mechanism capable of fully funding cyanide related decommissioning activities.*

- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 5.2**
- not in compliance with

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

Basis for Audit Finding: Lagunas Norte has developed cost estimates with sufficient detail for the full closure of the cyanide-related facilities and activities. Barrick is providing a corporate self guarantee to cover the full cost of cyanide facility decommissioning at Lagunas Norte. In support of the corporate self guarantee, Lagunas Norte provided audited financial statements for Minera Barrick Misquichilca S.A. and a report from qualified financial auditors that evaluated Barrick audited financial records for their ability to meet financial tests for financial self guarantee for its cyanide-related decommissioning activities using 40 CFR 264.143(f), 30 CRF 800.23, and 10 CFR 30, and in accordance with attestation standards established by the American Institute of Certified Public Accountants.

6. WORKER SAFETY: *Protect workers' health and safety from exposure to cyanide.*

Standard of Practice 6.1: *Identify potential cyanide exposure scenarios and take measures as necessary to eliminate, reduce and control them.*

in full compliance with

The operation is in substantial compliance with **Standard of Practice 6.1**

not in compliance with

Basis for Audit Finding: Lagunas Norte has identified potential cyanide exposure scenarios and developed procedures and plans to eliminate, reduce and control exposure. Lagunas Norte operating plans and individual task specific SOPs provide details for safe operation of cyanide equipment, personal protective equipment requirements and inspection requirements. Lagunas Norte has successfully implemented a program where job safety assessments are completed and documented prior to every cyanide related task. Lagunas Norte has weekly Process Group Meetings to provide information and training to employees as well as solicit input from employees on worker safety issues. Lagunas Norte has a Change Management procedure ("Manejo Del Cambio") that requires any proposed changes in process operations and cyanide management be formally evaluated with the area supervisors prior to implementation. All changes are communicated to the workforce and training requirements updated.

Standard of Practice 6.2: *Operate and monitor cyanide facilities to protect worker health and safety and periodically evaluate the effectiveness of health and safety measures.*


in full compliance with

The operation is in substantial compliance with **Standard of Practice 6.2**

not in compliance with

Basis for Audit Finding: Lagunas Norte has developed SOPs for the cyanide usage areas designed to prevent the generation of hydrogen cyanide (HCN) gas and has located key cyanide process facilities outside or in well-ventilated buildings with appropriate HCN monitors. Lagunas Norte has defined process equipment and standard operational plans for control of cyanide, caustic, pH, and

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

Hydrogen Peroxide. There are HCN sensors and alarms located at the cyanide mixing and storage tanks. Lagunas Norte has developed extensive HCN monitoring information for all operator tasks using mobile HCN detectors. Monthly surveys are completed with HCN monitors at pre-set survey locations with the data being evaluated and compiled to monitor work practices and evaluate potential areas of concern. Lagunas Norte also has mobile HCN detectors for use in confined space entry. Lagunas Norte has established requirements for personal protective equipment at all relevant process areas and for all cyanide-related activities. Lagunas Norte has implemented monitoring equipment maintenance and calibration programs. Lagunas Norte has installed safety showers with eyewash stations and non-acidic fire extinguishers at relevant cyanide usage areas. Lagunas Norte provides the cyanide safety information (Material Safety Data Sheets and first aid procedures) at all key process locations and on the Lagunas Norte Intranet. Lagunas Norte has implemented an accident investigation process to report and investigate all cyanide related incidents.

Warning signs are located in areas of cyanide usage to alert workers that cyanide is in use and include the use of PPE. Unloading, storage, mixing and process tanks and piping containing cyanide are identified to alert workers of their contents, and the direction of cyanide flow in pipes is designated.

Standard of Practice 6.3: *Develop and implement emergency response plans and procedures to respond to worker exposure to cyanide.*


 in full compliance with

The operation is in substantial compliance with **Standard of Practice 6.3**

 not in compliance with

Basis for Audit Finding: Lagunas Norte has developed an Emergency Response Plan and implemented the Plan through training and installation of emergency response equipment. Lagunas Norte has safety equipment including safety showers with eyewash stations, first aid equipment (amyl nitrite, medical oxygen, and resuscitator), an emergency response vehicle, and employee first aid training. Lagunas Norte has an Emergency Response Team for all shifts. The team is trained to provide first aid for cyanide exposure including oxygen and amyl nitrite administration. Lagunas Norte has a program to store and replace cyanide exposure antidotes in accordance with the manufacturer's requirements at several locations on the property. In the event of a worker exposure, Lagunas Norte will provide onsite first aid. Lagunas Norte has an onsite medical facility that is always staffed by at least one physician. The onsite medical physician will provide intravenous cyanide antidote for treatment of the patient if required. Lagunas Norte has conducted cyanide exposure drills, and tests the relevant emergency procedures three times during 2007.

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

7. EMERGENCY RESPONSE: *Protect communities and the environment through the development of emergency response strategies and capabilities.*

Standard of Practice 7.1: *Prepare detailed emergency response plans for potential cyanide releases.*

- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 7.1**
- not in compliance with

Basis for Audit Finding: Lagunas Norte has developed and implemented an Emergency Response Plan (ERP) and procedures to respond to cyanide related emergencies and emergency control management that address potential cyanide releases including containment plans and analysis of potential scenarios. The emergency response plans will be evaluated and updated at least annually or as needed by the results of mock drills or actual events.

Standard of Practice 7.2: *Involve site personnel and stakeholders in the planning process.*

- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 7.2**
- not in compliance with


Basis for Audit Finding: The ERP has been designed to be implemented entirely by trained, onsite personnel. Lagunas Norte has onsite fire fighting capabilities, a fully equipped emergency response vehicle, a hazmat vehicle and trained First Responders, firefighters and hazmat personnel. Lagunas Norte emergency response teams are trained to respond to all potential cyanide incidents at the site. Lagunas Norte's Emergency Response Plan has been developed with the involvement and input of its workforce. Lagunas Norte's workforce has the ability to participate in the emergency response planning process through weekly safety meetings and mock drills. Lagunas Norte involves site personnel in mock drills and revises the emergency response procedures as needed.

Standard of Practice 7.3: *Designate appropriate personnel and commit necessary equipment and resources for emergency response.*

- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 7.3**
- Not in compliance with

Basis for Audit Finding: Lagunas Norte has committed, in the ERP and training SOPs, the necessary emergency response equipment and first aid to manage all cyanide incidents at the operation and to coordinate transportation to the nearest medical facilities. Lagunas Norte has

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

certified First Responders, firefighters and hazmat personnel. Lagunas Norte's ERP defines the primary and alternative response coordinators for the Incident Command Team (ICT). The ICT is commanded by an Incident Commander Leader, who is trained for emergencies in that department. The ERP has a list of potential team members and Commanders in the event that the Department Supervisor is not available. The Incident Commander and ICT are responsible for the overall management of the emergency (human resources, equipment, material and supplies, communication, production and decisions) at the site. The ERP contains a list of onsite emergency responders, the ambulance service and the local medical providers. Lagunas Norte requires training and certification for First Responders, including administering first aid to personnel exposed to cyanide, administering amyl nitrite, locations of cyanide antidote kits, hazard awareness associated with sodium cyanide and HCN gas, and victim and rescuer decontamination procedures. The ERP includes radio channel, office and 24-hour cell phone telephone numbers for the Emergency Response Team and Commanders. The ERP has a section describing Lagunas Norte Personnel Duties and Responsibilities for the Incident Commander and Manager Succession. The section details the responsibilities of the Incident Commander and the Loss Control and Environmental Departments. The ERP contains a list of emergency response equipment for the onsite transportation route. All emergency equipment and supplies are inspected monthly by the Loss Control Department.

Standard of Practice 7.4: *Develop procedures for internal and external emergency notification and reporting.*

 in full compliance with
The operation is in substantial compliance with **Standard of Practice 7.4**
 not in compliance with


Basis for Audit Finding: Lagunas Norte's Emergency Response Plan and related facility plans detail the procedures (including current contact telephone numbers) for internal and external emergency notification and reporting.

Standard of Practice 7.5: *Incorporate into response plans and remediation measures monitoring elements that account for the additional hazards of using cyanide treatment chemicals.*

 in full compliance with
The operation is in substantial compliance with **Standard of Practice 7.5**
 not in compliance with

Basis for Audit Finding: Lagunas Norte has prepared cyanide response and remediation plans that address appropriate uses and situations for cyanide treatment chemicals. Lagunas Norte has developed plans to sample and monitor soils and groundwater in the event of a cyanide spill. All contaminated soils are to be excavated, loaded, hauled and disposed of in the heap leach facility. Liquid spills are to be contained by perimeter berms and pumped into containers for return to the process facilities. Sodium hypochlorite is only to be used in cases where the solution is fully contained on site and will not encounter aquatic life.

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

Standard of Practice 7.6: *Periodically evaluate response procedures and capabilities and revise them as needed.*

in full compliance with
The operation is in substantial compliance with **Standard of Practice 7.6**
 not in compliance with

Basis for Audit Finding: Lagunas Norte has committed to annual evaluation and update of the Emergency Response Plan, if needed based on review of the incidents and drills. Additionally, at least once per year Lagunas Norte will conduct hazmat emergency response drills. Lagunas Norte has conducted three cyanide related mock drills in 2007.

8. TRAINING: *Train workers and emergency response personnel to manage cyanide in a safe and environmentally protective manner.*

Standard of Practice 8.1: *Train workers to understand the hazards associated with cyanide use.*

in full compliance with
The operation is in substantial compliance with **Standard of Practice 8.1**
 not in compliance with


Basis for Audit Finding: Lagunas Norte provides training to all employees, with the potential to be exposed to cyanide, on the hazards of cyanide and provides annual refresher training. Lagunas Norte retains all cyanide training records for employees. The cyanide related performance assessment tests are also retained in employee permanent records.

Standard of Practice 8.2: *Train appropriate personnel to operate the facility according to systems and procedures that protect human health, the community and the environment.*

in full compliance with
The operation is in substantial compliance with **Standard of Practice 8.2**
 not in compliance with

Basis for Audit Finding: Lagunas Norte has prepared and implemented SOPs for cyanide management tasks that detail health and safety procedures for all aspects of cyanide unloading, handling, mixing and storage, heap leach operations, Merrill Crowe operations, and cyanide destruction systems.

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

Lagunas Norte has an extensive training program that includes New Hire, Work Specific, and Specific Procedure training. New hire training is given to all employees and covers cyanide hazard recognition, health effects, safe practices, basic PPE, general emergency procedures in case of spills or inhalation risk, and communication requirements. The work specific training is given to employees and contractors that have the potential to be exposed to cyanide. The work specific training includes more detail on cyanide safety, first aid and antidote use, PPE requirements and specific work area cyanide management procedures. The procedure training is task specific training provided by employee supervisors covering cyanide handling and mixing, heap leach operations, Merrill Crowe plant operation, and cyanide destruction system operation. All task-specific training is conducted by individuals that have undergone a "Train the Trainer" course, have at least two years of working in the process area, and degrees in either chemistry or engineering. Lagunas Norte's training program identifies the specific cyanide management elements that each employee must be trained in to perform that specific job properly. All Lagunas Norte employees, with the potential to be exposed to cyanide, receive annual refresher training that includes cyanide safety. Lagunas Norte employees working in specific cyanide management tasks receive annual refreshers for those tasks. Lagunas Norte requires written tests to evaluate the effectiveness of cyanide training and those training records are retained throughout an individual's employment, documenting the training received. The records include the name of the employee and the trainer, the date of training; the topics covered, and test results demonstrating an understanding of the training materials.

Standard of Practice 8.3: Train appropriate workers and personnel to respond to worker exposures and environmental releases of cyanide.


- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 8.3**
- not in compliance with

Basis for Audit Finding: Lagunas Norte has provided training in response to cyanide releases for all production and maintenance personnel and developed a First Responder Team. Lagunas Norte has developed procedures and plans for cyanide-related tasks. The Emergency Response Plan, the Operation Pre-Plans and procedures define the response required by operators if a person is exposed to cyanide or if there is an environmental release. All Lagunas Norte employees, with the potential to be exposed to cyanide, receive annual refresher training that includes cyanide safety, cyanide hazards recognition, first aid, and incident response. All training records by individual employee are retained.

Lagunas Norte has an Emergency Response Team comprised of full-time employees trained in first aid and use of resuscitation equipment.

Lagunas Norte, over the last three years, has conducted two mock cyanide emergency response drills per year that include both human exposure and environmental release. The drills are analyzed and improvements made to training procedures and the emergency response plan as required by the drill results. Lagunas Norte is committed to conduct several mock drills per year.

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date

9. DIALOGUE: *Engage in public consultation and disclosure.*

Standard of Practice 9.1: *Provide stakeholders the opportunity to communicate issues of concern.*

- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 9.1**
- not in compliance with

Basis for Audit Finding: Lagunas Norte provides the opportunity to communicate issues of concern with the public through contact with the local stakeholders during presentation of workshops. In addition, Lagunas Norte has developed an Open Door Policy that allows community members to voice complaints and concerns related to the mine operation and transportation of supplies.

Standard of Practice 9.2: *Initiate dialogue describing cyanide management procedures and responsively address identified concerns.*


- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 9.2**
- not in compliance with

Basis for Audit Finding: Lagunas Norte has a number of programs where they initiate dialogue with the communities related to cyanide management procedures. These programs include public mine visits and tours, publication of a monthly magazine, preparation of informational pamphlets, organization of university based workshops on mining issues, development of a Road Safety and Transport community relations workshop and development of Complaints and Questions Program. Mine visits include a tour of the crushers, mining area, process plant, dikes and leach areas, and an overview from the general lookout. Lagunas Norte provides the following pamphlets during mine visits, workshops and local fairs:

- Así Hacemos Nuestras Exploraciones Mineras (How we do our mining exploration activities)
- Así Transportamos Cianuro (How we Transport Cyanide)
- Así manejamos el CN en Lagunas Norte (two versions) (How we handle cyanide in Lagunas Norte, two versions)

The pamphlets are easy to follow and are focused to teach safe practices and information regarding cyanide and gold production at the mine. These pamphlets are distributed at site visits and any other event where mine personnel participate. Lagunas Norte also promotes workshops at local universities, schools and institutes where cyanide and other mining related subjects are discussed.

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor


Dec. 6, 2007
Date

Standard of Practice 9.3: *Make appropriate operational and environmental information regarding cyanide available to stakeholders.*

- in full compliance with**
- The operation is** in substantial compliance with **Standard of Practice 9.3**
- Not in compliance with

Basis for Audit Finding: Lagunas Norte is required by Peruvian regulations to provide operational and environmental information related to cyanide exposures and emergencies, spills, and offsite releases of cyanide on a quarterly basis. These quarterly reports are available on request from the Peruvian Ministry of Energy and Mines. The Ministry also makes information available on the mines on their website (http://www.minem.gob.pe/mineria/pub_informe_fiscaliza.asp). Barrick provides operational and environmental information in its annual corporate safety and health, environment and social responsibility reports, and on its websites (www.Barrick.com and www.Barrick.com.pe).

Lagunas Norte Mine
Name of Facility


Signature Lead Auditor

Dec. 6, 2007
Date